

MONUMENT RECORD

Corner I.D. #



Q-14

STATE OF INDIANA - COUNTY OF MONROE

Section Twenty-two (22), Township 10 North, Range 1 West

Monument Description & Remarks: Trapezoid stone 7.5" x 8.5", 9" exposed,
found at SE Corner of NE 1/4 of NE 1/4. Stone was marked with "X"; steel
fence post adjacent. Corner witnessed 10/1/85.

Recovery Tie Drawing

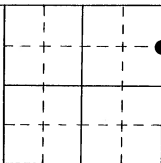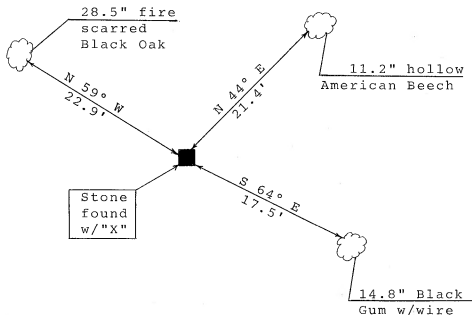

● At Corner



Not To Scale

State of Indiana

County of Monroe

I, Michael W. Freiley, County Surveyor, hereby certify
 that this document was prepared under my direction in
 accordance with the provisions of Section 17-3-64-4
 through 17-3-64-8 of the Indiana Code, being Acts of 1965,
 Chapter 319; and the above data is given under my hand and
 seal this 4th day of November, 19 93 A.D.

Space
 Reserved For
 Recording
 Officer

Indiana Registered Land Surveyor No. _____ or

Morgan-Monroe State Forest
United States Government Agency

Darrell Breedlove, Timber Specialist
 Title

Field Book:

n/a

Page:

n/a

SECTION 22, T 10 N, R 1 W

1. On December 12, 1983, boundary line work in the section was begun as follows:

- A --a lath marked SEC 23 corner was located at the NE corner SEC 22.
 B --a stone with a pipe driven next to it was located at SE corner $NE\frac{1}{4}$, $NE\frac{1}{4}$ (it was not witnessed).
 C --a compass reference line was run south from the lath (1° W declin). The line was $\pm 22'$ W of the stone at SE corner $NE\frac{1}{4}$, $NE\frac{1}{4}$ (distance paced, not measured).

Darrell Breedlove, Timber Specialist

2. October 1, 1985

--two stones were witnessed as follows:

*NOT SAME STONE -
FIELD CHECK!*

A NW corner, $NE\frac{1}{4}$, $NE\frac{1}{4}$ --See SE corner, $W\frac{1}{2}$, $SE\frac{1}{4}$, SEC 15			
B SE corner, $NE\frac{1}{4}$, $NE\frac{1}{4}$ --Trapezoid stone $7\frac{1}{2} \times 8\frac{1}{2} \times 9$ (wx1Xh) w/ "X" and steel pipe by it			
Azimuth ($^\circ$)	116 $^\circ$	044 $^\circ$	301 $^\circ$ N $47' W$
Species	BLG	AMB	BLO
	w/wire	hollow	fire scarred
DBH _{ob} (in)	14.8	11.2	28.5
Distance (')	17.5	21.4	22.9

11-4-93

- C --three pipes and lathes were located on east side of $\frac{1}{4}$ - $\frac{1}{4}$ *
 Distance N of SE corner, $NE\frac{1}{4}$, $NE\frac{1}{4}$
 --approx 3.3 chains--NW corner of Tract 1
 --approx 14.6 chains--SW corner of Tract 6
 --approx 19.4 chains**--NW corner of Tract 6

*subdivision in SEC 23 (Lee Hutt, surveyor)

**34' south of lath marking NW corner SEC 23 which sits on NW side, next to a 14.4" DBH Black Oak with witness nails at 2 ft. above the ground.

The three pipes and the lath are on a line running Az 359° from SE, $NE\frac{1}{4}$, $NE\frac{1}{4}$ stone.

- D --the SW corner, $NE\frac{1}{4}$, $NE\frac{1}{4}$ was established by wire evidence that agreed closely with stones at the NW and SE corners:

AZ	269 $^\circ$	30'	(1° W declin.) from SE stone
AZ	179 $^\circ$		(1° W declin.) from NW stone

--the E, S, and W sides of the $\frac{1}{4}$ - $\frac{1}{4}$ were painted and posted w/ plastic signs.

--Refer to SEC 15, T 10 N, R 1 W Entry #3 about offset between SEC 22 & SEC 15.

Darrell Breedlove, Timber Specialist